

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-023772**Date Inspected:** 11-May-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Li yan hua**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Components**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, S.Chandrakumar was present during the times noted above for observations relative to the work being performed.

BAY#19

FCAW welding of repair weld is identified as 1G-009 of SA6533-001for SA6533. The welder is identified as 062807. ZPMC QC is identified as Mr. Li ping. The welding variables recorded by QC are appeared to comply with the WPS-345-FCAW-1G (1F)-ESAB- repair and WR20950.

FCAW welding of weld is identified as 3F-054 of BK25A6-001 for BK25A. The welder is identified as 062757. ZPMC QC is identified as Mr. Li ping. The welding variables recorded by QC are appeared to comply with the WPS-B-T-2133-ESAB.

FCAW welding of weld is identified as 4F-047 of BK25A6-001 for BK25A. The welder is identified as 208641. ZPMC QC is identified as Mr. Li ping. The welding variables recorded by QC are appeared to comply with the WPS-B-T-2134-ESAB.

FCAW welding of weld is identified as 2F-188 of BK25A7-001 for BK25A. The welder is identified as 208632. ZPMC QC is identified as Mr. Li ping. The welding variables recorded by QC are appeared to comply with the WPS-B-T-2132-ESAB.

FCAW welding of weld is identified as 4F-010 of BK25A5-001 for BK25A. The welder is identified as 208641.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

ZPMC QC is identified as Mr. Li ping. The welding variables recorded by QC are appeared to comply with the WPS-B-T-2133-ESAB.

FCAW welding of weld is identified as 4F-029 of BK23A6-001 for BK23A. The welder is identified as 208641. ZPMC QC is identified as Mr. Li ping. The welding variables recorded by QC are appeared to comply with the WPS-B-T-2134-ESAB.

FCAW welding of weld is identified as 3F-025 of BK23A6-001 for BK23A. The welder is identified as 062757. ZPMC QC is identified as Mr. Li ping. The welding variables recorded by QC are appeared to comply with the WPS-B-T-2133-ESAB.

This QA inspector performed UT 10% of weld areas previously tested and accepted by ZPMC Quality Control personnel. This QA inspector generated an UT report for this date. The members are identified as OBG Cable bracket. The weld designations reviewed as follows.


SA6029-001-022,023,025,058,059,061,129,134,030,084

SA6030-001-022,023,025,058,059,061,129,134,

SA6031-001-033,035,036

SA6031-002-047,048,049,095,104,096,102

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

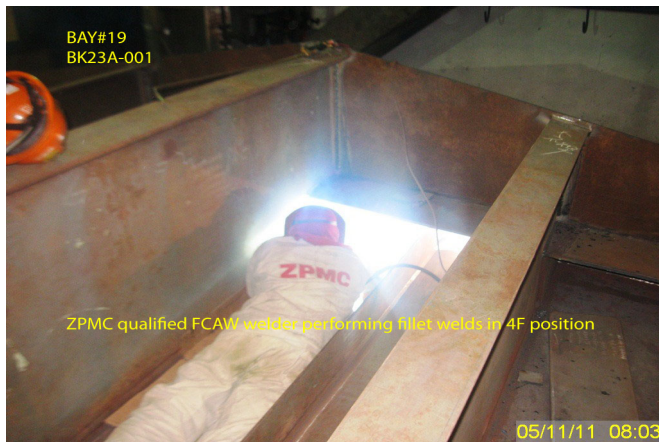

Summary of Conversations:

No relevant Conversation.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang-15--0042-2372, who represents the Office of Structural Materials for your project.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Inspected By: Kumar,Chadra

Quality Assurance Inspector

Reviewed By: Patel,Hiranch

QA Reviewer